



# Pyrometer CellaTemp PX 4x, 5x, 6x

Ident no.: 1102810 12/2020



#### Content

1	General
	1.1 Information about the manual
	1.2 Explanation of the symbols
	1.3 Liability and Warranty
	1.4 Copyright
	17 0
2	Safety
	2.1 Intended use
	2.2 User's responsibility
	2.3 Safety requirements
	2.4 Laser Radiation Hazard
3	Shipping, packaging and disposal
J	3.1 Inspection after shipping
	3.2 Packaging
	3.3 Disposal oft he old devices
	'
4	Theory of Non-Contact Temperature Measurements
	4.1 Advantages of Non-Contact Temperature Mesasurement
	4.2 Measurements at Black Bodies (Cavity Radiators)
	4.3 Measurements of Real Radiators1
	4.4 Measurements errors1
5	Ways to determine emissivity (one-colour mode)1
6	Function1
7	In adultation 4
1	Installation
	7.1 Assembly
	7.2 Alignment
	7.3 Focussing
8	Electrical connection
9	Setup1
	9.1 Setup two-clour mode
	9.2 Setup one-colour mode1
	9.3 Transmission factor (one-colour mode)

-	
-	V.

10	Shielding and Grounding	17
11	Operating control and display  11.1 Processing of measuring signals  11.2 Analogue output  11.3 Switching threshold OUT 1  11.4 Output signal  11.5 Switch on delay  11.6 Switch off delay  11.7 Hysteresis function  11.8 Window function  11.9 Switching output OUT 2  11.10 Dirt alert  11.11 Damping function  11.12 Peak hold function  11.13 ATD function  11.14 IO-Link	19 20 20 21 22 23 23 24 24
12	Menu	29 30 31 32 33
13	Menu explanation  13.1 Analogue output  13.2 OUT 1 (d ! )	36 37 38 40
14	Parameterizing	
15	Error indications.	44

16	Service functions	45
	16.1 Reset all parameters to factory settings	45
	16.2 Simulate a desired temperature	45
17	Maintenace	46
	17.1 Cleaning the pyrometer lens	
	17.2 Replacing the protective screen	
18	Models	47
19	Field of view	48
20	General technical data	49
21	Device-specific technical data	51
22	Field of view camera	59
23	Accessories	61
24	Default settings	61
25	Copyright	61



#### 1 General

#### 1.1 Information about the manual

The purpose of the Operating Manual is to provide the user with all necessary information to be able to install the pyrometer and any necessary accessories. Before starting installation, be sure to read and understand this entire manual, in particular the chapter on safety! The instructions contained in this manual, especially those concerning safety, as well as site specific regulations governing UV radiation must be complied with at all times. It is imperative to comply with the safety instructions and the accident protection regulations valid for the area of application!

#### 1.2 Explanation of the symbols

Important safety-related references in this manual are marked with a symbol.

# **A** ATTENTION

This symbol points out guidelines. If you do not observe them, the device might be damaged, malfunctioning or even fail to operate.

- CAUTION
  - This symbol points out guidelines which should be followed for efficient and trouble-free operation.
  - Action
     This symbol instructs the operator to take action.
  - > Reaction, result This symbol indicates the result of the action taken.

#### 1.3 Liability and Warranty

All information compiled in this manual is in accordance with applicable regulations. The statements made are based on state-of-the-art technology and reflect our extensive knowledge and many years of experience.

Always carefully read this Operating Manual before beginning any work on or with the instrument, especially prior to installation and initial setup!

The Manufacturer shall not be held liable for any damages or malfunctions arising from a disregard of the warnings and instructions contained herein.

#### 1.4 Copyright

This Operating Manual should be treated as confidential. It is solely intended for the use by persons involved with the instrument. This manual may not be made available to a third party without prior Manufacturer's consent. Please contact the Manufacturer if the need should arise

# 2 Safety

This chapter outlines all important safety aspects to be considered for optimum employee protection and to ensure safe and reliable operations.

#### 2.1 Intended use

The pyrometer is solely intended for use as described in this manual. Operational safety can only be ensured when the instrument is used for its intended purpose.



The use of the pyrometer for any other purpose beyond what is specified in this manual is prohibited. Using the instrument in any other manner will be considered as improper.

The manufacturer is only liable for damage that occurs during correct use. The prerequisite for any liability, however, is that the cause of the damage is due to a defective product and the defect in the product was caused by the manufacturer

#### 2.2 User's responsibility

The pyrometer may only be used when it is in perfect working condition.

#### 2.3 Safety requirements

The instrument operates at low voltage (18 - 34 V DC). The power supply unit must conform to directive EN 50178, SELV, PELV.



#### 2.4 Laser Radiation Hazard

#### Laser radiation can be harmful to the eye!

The CellaTemp PX with laser operates with a class 2 red light laser. Direct prolonged viewing of a laser beam can injure the retina. Therefore, the following safety precautions must be strictly observed, otherwise the laser may not be operated!

- Only use the laser to align and focus the pyrometer. Deactivate the laser immediatley afterwardsAlternatively, the laser will automatically switch off after 2 minutes.
- Never look directly into the laser beam path
- Do not leave the instrument unattended when the laser is activated.
- Do not point th elaser beam at any person
- During pyrometer installation and alignment, make sure to avoid the possibility of laser reflections caused by reflective surfaces.
- · All currently valid laser safety standards must be observed.

#### Laser power

The laser operates at a wavelength of 630 - 680 nm (visible red light). The emitted power of the laser beam at the lens opening is max. 1.0 mW. Under normal operating conditions, the emitted radiation does not present a danger to human skin. This laser product is classified according to laser class 2, EN60825-1, IEC60825-1.

#### **Laser Warning Label**

The black and yellow laser warning label is affixed next to nameplate of the instrument. An arrow indicates the laser emission path (lens opening).





If the pyrometer is installed within, a machine or equipment in such a way that the instrument's warning label is visibly blocked, additional laser warning labels (not included in scope of delivery) must be affixed to the equipment or accessory in immediate vicinity to the laser beam emission path opening.

# 3 Shipping, packaging and disposal

#### 3.1 Inspection after shipping

Unpack and inspect the entire shipment immediately upon receipt to make sure it is complete and undamaged. If the container/package shows visible signs of damage, please refuse the shipment. If this is not possible, accept the shipment on the condition that the freight carrier's delivery record is noted with the extent of the damage in order to file a claim. Should you discover a concealed loss or damage, report it to the shipper or freight carrier immediately. If the period for filing claims has expired, you will no longer be able to make any claims for compensation of damage or loss.

#### 3.2 Packaging

The packages used are made of carefully selected, environmentally compatible materials and are thus recyclable. Please ensure that they are disposed of in an ecologically sound manner.

#### 3.3 Disposal oft he old devices



Old electrical and electronic devices frequently still contain valuable materials. These devices can be returned for disposal to the manufacturer or they must be disposed properly by the user.

For the improper disposal of the device by the user, the company KELLER HCW is not responsible.

# **4 Theory of Non-Contact Temperature Measurements**

All materials radiate thermal energy in all states of aggregation above absolute zero. This radiation is mainly caused by atomic or molecular oscillations.

This temperature radiation is only a limited sector within the total electromagnetic radiation spectrum. It extends from the visible range starting at wavelengths of approx. 0.5 µm to the infrared range with wavelengths of more than 40 µm. Radiation pyrometers detect infrared radiation for non-contact temperature measurement.

#### 4.1 Advantages of Non-Contact Temperature Mesasurement

- Non-contact temperature detection means cost-effective temperature
  measurement because this technique only requires a single in-vestment in an
  instrument without any follow-up costs for consumables such as thermocouples
- This method enables temperature detection of moving objects quick temperature measurements within milliseconds for example at automatic welding processes
- Small objects with medium and high temperatures can also be easily and accurately measured
- When measuring materials with low specific heat, a non-contact method does
  not induce heat loss which would distort the temperature reading (as is the
  case with contact temperature probes). Non-contact temperature detection
  is ideal with corrosive molten materials for which the use of thermocouples is
  hardly feasible
- Last but not least it is also possible to measure the temperature of voltage-carrying objects.

#### 4.2 Measurements at Black Bodies (Cavity Radiators)

A black body or a black radiator is used to calibrate radiation pyrometers. This black body is designed in a way that its radiation does not depend on material characteristics, but only on its temperature. A black body emits at any wavelength the maximum energy possible for the specific temperature. Real bodies do not have this ability. In other words, a black body completely absorbs the radiation without reflection or transmission losses. The spectral emissivity coefficient  $\epsilon(\lambda)$  of a black body is equal to 1 or 100 %.



The emissivity coefficient indicates the ratio of radiation of a real body (target) to the radiation of an ideal black body (target) to the radiation of an ideal black body.

$$\varepsilon(\lambda) = \frac{M}{M_s}$$

 $\varepsilon(\lambda)$ : Emissivity coefficient of the object's surface (targeted spot) at wavelengh  $\lambda$ 

M: Emissivity coefficient of the object's surface (targeted spot) at wavelength

MS: radiant energy emitted by a black body (perfect radiator)

Most burning, annealing and hardening furnaces emit a radiation of nearly ,1' which corresponds to the conditions of a black body if the aperture through which the measurement is made is relatively small.

#### 4.3 Measurements of Real Radiators

Real radiation sources are characterized by the relation of the emitted radiation to the radiation of a black body with the same temperature. Measurements outside a furnace - which applies to all other self-contained targets - always show a reading which is too low. Considerable errors can occur at targets with reflecting, polished or bright surfaces, e.g. molten steel and metal without oxide layer and ceramic materials. Exact results can only be obtained when the emissivity coefficient is correctly adjusted on the pyrometer. The spectral emissivity coefficient of a body does not represent an exact material constant, but is also largely dependent on the surface properties (— Ways to determine emissivity).

#### 4.4 Measurements errors

The cause of measurement errors in the use of pyrometers is often an incorrectly determined or wrong emissivity. Another source of error is the reflected "background radiation". If the measurement object has a low emissivity and there are hotter objects in the surrounding area, measurement results can be affected. These objects then have to be shaded. This effect is particularly to be observed in the measurement of a colder object within a hot oven.

ΕN

# 5 Ways to determine emissivity (one-colour mode)

Technical literature or operating manuals often contain data on the emissivity of various materials. This information should be used with caution, however. It is important to know for which temperature and which wavelength the emissivity value is applicable. Furthermore, the stated emissivity values were obtained under ideal conditions. In actual practice, the total emissivity of the target object will vary, depending on the amount of extraneous radiation transmitted through the object from the background or reflected onto the object from the foreground. The emissivity can be determined using one of the following methods:

#### Contact measurements

Measure the temperature with a contact thermocouple and measure the surface temperature with a pyrometer. Adjust the emissivity coefficient on the pyrometer until both devices show the same temperature. When measuring with the thermocouple, make sure to have good thermal contact and low heat dissipation.

#### Using a reference emissivity coefficient

Apply matte black colour to a part of the surface to be measured. This part has an emissivity of 94 %. At first, measure the temperature of the coloured part. Then make a comparative measurement right next to the coloured part and adjust the emissivity on the pyrometer until it displays the previous measurement reading again.

#### 6 Function

The pyrometer detects the radiated infrared radiation of objects without contact and converts them into an electrical switching signal and an analogue output signal.

#### 7 Installation

#### 7.1 Assembly

The pyrometer should be mounted where it is not unnecessarily exposed to smoke, heat or water vapour.

Contamination of the lens can lead to measurement errors. Therefore, always make sure that the lens is clean.




The pyrometer's field of view must remain unobstructed. Any interference from objects must be avoided.

# **A** ATTENTION

At an ambient temperature > 65 °C, the pyrometer must be cooled or protected against radiation by a shielding plate.

#### 7.2 Alignment

Align the pyrometer with the object to be measured. The pyrometer should, if possible, be installed at an angle of 90  $^{\circ}$  to the measuring object. The angle should not be less than 45  $^{\circ}$  from the vertical. When measuring with a two-colour pyrometer, the field of view does not have to be filled entirely by the target object.

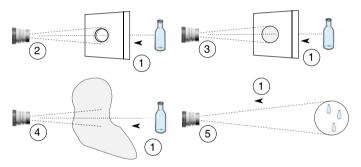

1	Radiated energy
2	Visibly smaller than measuring spot
3	Lens or protective screen contaminated
4	Steam, dirt or gas in the atmosphere
5	Object is smaller than the measuring field or object is moving

If the pyrometer is operated in spectral measurement mode, the measurement object must completely fill the measuring field.

infrared temperature solutions

#### 7.3 Focussing

For correct temperature measurement, it is important that the pyrometer is correctly focused on the target to be measured.

#### Pyrometer with through-lens sighting

When aiming the pyrometer with through-the-lens sighting to a target, both the targeted object and the target marker (distinctly marked circled spot in the viewfinder) must appear in sharp focus simultaneously.

#### Pyrometer with camera

The pyrometer models Typs PX xx AF xx /C features an integrated camera.

The video simplifies the optical alignment of the pyrometer and allows for continuous observation of the measuring point.

To measure, the pyrometer must be aligned and focused so that the video image is sharp (see chapter "Technical Data").

#### Pyrometer with laser sighting

The pyrometer models PX xx AF xx / $\underline{\textbf{L}}$  feature a laser spot light which can be activated to facilitate instrument alignment to the target spot.

To activate the laser, press the MODE button on the rear panel for 2 seconds For measuring, the pyrometer must be aligned and focused so that the pilot light is shown as sharp and round light spot at the measuring distance.



Information on the laser output can be found in chapter 2.4

To protect the laser against overload, an overtemperature circuit is provided. At temperatures above 60 °C, the laser switches off and can no longer be activated. To check, whether the laser is activated, the parameter LED lights up.

In normal operation of the pyrometer, the laser is switched off. After activation, the laser switches off again after 2 minutes. The operator must be familiar with the pyrometer and the above safety guidelines.




The switched-on laser pilot light can have an influence on the measured temperature. The influence depends on the type of device and the measured temperature.



### 8 Electrical connection

# **A** ATTENTION

- The pyrometer may only be installed by a skilled, qualified electrician. Do not connect the instrument while the voltage supply source is turned on. Please observe international safety regulations at all times.
- The pyrometer is supplied with low voltage 24V DC. The power supply unit must conform to directive EN50178, SELV, PELV.
- ► Switch to neutral and verify absence of voltage
- ▶ Connect the instrument according to the following schematic:

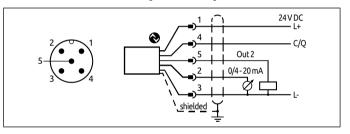

Pin 1	BN (brown) L+ (Power supply 24V DC)		
Pin 4	Pin 4 BK (black) Open Collector switching output; Imax = 150 mA IO-Link OUT 1		
Pin 5	GY (grey)	Open Collector switching output; Imax = 150 mA OUT 2	
Pin 2	WH (white)	Analogue output; 0/4 - 20mA	
Pin 3	BU (blue)	L- (GND)	

- !
- The pyrometer must be protected against high voltage and strong electromagnetic fields. Use a shielded cable, connecting it via connector casing to the device housing.
- **!**

Use a flyback diode when switching inductive loads.

EΝ

# 9 Setup

The pyrometer uses the intensity of infrared radiation for the non-contact temperature measurement.

The pyrometer PX can be used as spectral or two-colour pyrometer.

When delivered, the pyrometer is configured for the two-colour measurement.

#### 9.1 Setup two-clour mode

The two-colour measuring method detects the infrared radiation at two different wavelengths and calculates the quotient from the values obtained. This measurement method is suitable for measurements of targets that are partially obscured (either intermittently or permanently) by other objects, openings, screens or viewing windows that reduce energy, and by dirt, smoke, or steam in the atmosphere. The two color mode can also be used on targets that do not completely fill the target spot, provided the background is much cooler than the target.

#### Setting the emissivity ratio (two color mode)

The difference between measured temperature and true temperature can be compensated by changing the emissivity ratio. Make this adjustment for selective interferences or when the emissivity for wavelength 1 and wavelength 2 will be different because of the material that is being measured.

- Emissivity ratio [ $\P \cup$ ]  $\rightarrow$  [ $\P . E S P$ ] = 80 120 %
- ► Press [^ or V]
- > The value of the selected emissivity ratio is displayed, for example [ 10 00]
- ► Press [^ or ^] until the desired emissivity will show
- ▶ Press [Enter] or wait for 3 seconds
- > The current temperature value is displayed and the new emissivity coefficient is stored
  - !

When simultaneously pressing the MODE key, the display shows the current measuring temperature while the emissivity coefficient continues to be adjusted in the background. This is an easy way to determine the emissivity ratio when the object temperature is known. The changed values are directly adopted.

#### 9.2 Setup one-colour mode

By default, the pyrometer is set for quotient measurement. If the pyrometer is to be used as a spectral pyrometer, the configuration of the analogue output must be changed to spectral mode.

Measuring mode one-colour mode 
$$[A \circ ] \rightarrow [A \circ ] S = [L \ ]$$
 or  $[A \circ ] \rightarrow [A \circ ] S = [L \ ]$ 

Exact temperature readings in the operating mode "spectral measurement" can only be obtained when the emissivity of the target is correctly adjusted on the pyrometer. The pyrometer thus automatically compensates the reduced radiation by the lower emissivity.

- Emissivity:  $[L \ 1] \rightarrow [\ 'EPS] = 10...110\%$  or  $[L \ 2] \rightarrow ['\ 'EPS] = 10...110\%$
- ► Press [^ or v]
- > The value of the selected emissivity is displayed, for example [ 10 00]
- ▶ Press [^ or v] until the desired emissivity will show
- ▶ Press [Enter] or wait for 3 seconds
- > The current temperature value is displayed and the new emissivity coefficient is stored
- To compensate for environmental influences, it may be useful to have an emissivity of > 100 %. A setting of 110 % is possible.
- When simultaneously pressing the MODE key, the display shows the current measuring temperature while the emissivity coefficient continues to be adjusted in the background. This is an easy way to determine the emissivity when the object temperature is known. The modified values are directly adopted.
- Emissivity determination Chapter 5

#### 9.3 Transmission factor (one-colour mode)

Besides the emissivity correction, a pyrometer must be adjusted for the transmission properties of any supplementary lens and/or protective window screwed onto the pyrometer. Set the pyrometer for the specific transmission factor (a percentage value) which is indicated either in the product's data sheet or on the lens itself. If you are not using any auxiliary lens or protective window, set the parameter to 100.0 (default setting).

• Transmission factor [L I]  $\rightarrow$  [ 'L AU] = 1000 or [L 2]  $\rightarrow$  [' 'L AU]

# 10 Shielding and Grounding

The pyrometer housing is connected to the shielding via the cable connector!

Differences in ground potentials might cause an equalising current to flow between devices through a cable shielded at both ends. In this case, be sure to install an additional equipotential bonding line.

To avoid an equalising current, the pyrometer can be mounted electrically insulated. The shielding must be connected to the plant's earthing system.

# **A** ATTENTION

If the pyrometer is installed without an insulator and without potential equalisation, the interference voltage may not exceed 32V.

EN

# 11 Operating control and display



#### 1 to 4: Indicator-LEDs

- LED 1 = Switching state of switching output OUT1
- LED 2 = Switching state of switching output OUT2
- LED 3 = Laser pilot light active
- LED 4 = IO-Link Communication

#### 5: Control key [MODE]

- · Selection of parameters
- · Reading the set values
- · Confirmation of parameter values

#### 6: Control key [^] and [V]

- · Selection of parameters
- · Activation of emissivity quick adjustment
- · Confirmation of parameter values

#### 7: Alphanumeric display, 4-digit

- · Indicates temperature value
- · Indicates parameter and configuration
- · Display of errors

The pyrometer disposes of an IO-Link interface.

The generated three output signals correspond to the parameterization:

- Out 1: Switching output/ IO-Link
  - Switch signal: threshold value temperature / status signal
- Out 2: Switching output
  - Switch signal: threshold for temperature / status signal
- Analogue output: 0/4 -20 mA
  - Analogue output for temperature


#### 11.2 Analogue output

The pyrometer converts the measuring signal into a temperature proportional analogue signal of 0/4 - 20 mA. The maximum load is 500 Ohm.

[RoF \(\Omega\)] Changeover 0 -20 mA or 4 -20 mA

[RoSP] defines at which measured value the output signal is 0/4 mA.

 $[R \circ E P]$  defines at which measured value the output signal is 20 mA.

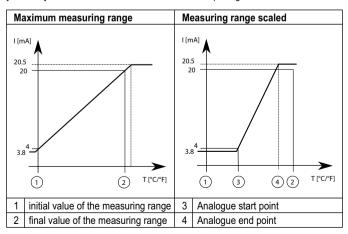



#### 11.3 Switching threshold OUT 1

OUT1 changes its switching status when the configured upper or lower thersholds [d 1.5 P d 1.7 P] are exceeded. Source d 1.5 specifies the signal that is output at OUT1.

Two-colur mode [d1] → [d1. 5] = 9

First, the switching point [d 1.5 P] is set in °C and °F and then the reset point [d 1.7 P]. When changing [d 1.5 P], the [d 1.7 P] also changes so that the difference remains the same. If the [d 1.5 P] is reduced to such an extent that the distance can no longer be maintained (as the [d 1.7 P] would otherwise move below its minimum), the [d 1.7 P] is increased to its minimum. If [d 1.5 P] is subsequently increased again, [d 1.7 P] is also increased again immediately. The minimum distance between [d 1.5 P] and [d 1.7 P] is 1 K.

#### 11.4 Output signal

The following output functions can be selected:

- Normally open contact [d 1] → [d 1.F n] = h n n hysteresis function, normally open or rather F n n window function, normally open
- Normally closed contact [d i] → [d iFn] = hnc hysteresis function, normally closed or rather Fnc windows function, normally closed

#### 11.5 Switch on delay

Once the sensor has detected a temperature which exceeds the switching threshold [d 1.5P] the time delay [d 1.d5] starts running. When this delay period has elapsed, the output OUT 1 activates switching. This status is sustained until the lower threshold [d 1.cP] is violated. If this occurs before the time delay has elapsed, the delay will reset. This function can be used, for example, to supress spurious impulse signals at the output.

Switching on delay: [d 1] → [d 1.d5] = 0...10 sec.


#### 11.6 Switch off delay

To make sure the output is correctly identified, e.g. by downstream control system, the output can be lengthened.

Switch off delay: [d i] → [d i.dr] = 0...10 sec.



### 11.7 Hysteresis function

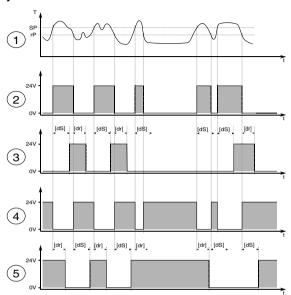

T = temperature P = P reset point t = time P = P switch on delay P = P set point P = P switch off delay

	•
1	Temperature
2	Switch signal hoo


3	Switch signal hoo	with switch on delay	y and switch off delay
---	-------------------	----------------------	------------------------

4 Switch signal boc

5 Switch signal hoc with switch on delay and switch off delay



#### 11.8 Window function

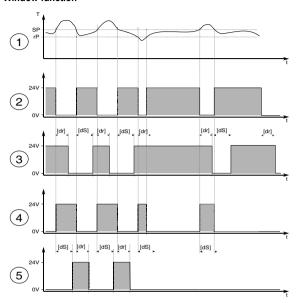

T = temperature P = P = lower limit value t = time P = P = switch on delay P = P = switch off delay

·	1	Temperature	
	2	Switch signal Foo	
	3	Switch signal F o o with switch on delay and switch off delay	
4	4	Switch signal Foc	
	5	Switch signal E o c with switch on delay and switch off delay	


The switching thresholds of the window function have a hysteresis of 0.25% of the measuring range.

# 11.9 Switching output OUT 2

OUT2 changes its switching state according to the adjusted function. The functions and parameters are the same as OUT 1.

#### 11.10 Dirt alert

A dirt alert function is available to ensure a safe measurement for the PX pyrometer. The dirt alert function warns the user if, for example, the lens, an attached protective glass or the sighting cone of the pyrometer gets dirty during a measurement



- 1 Target object
- 2 Visibility obstructed by vapour and dust
- 3 Deposits in the sight tube or kiln wall
- 4 Contaminated viewing window and/or contaminated lens
- 5 Pyrometer


The parameter dirt alert is activated with the parameter [d 1]  $\rightarrow$  [d 1.5] = d  $\cdot$  r or [d 2]  $\rightarrow$  [d 2.5] = d  $\cdot$  r. The dirt alert is a warning function. The warning will become when the set threshold [9]  $\rightarrow$  [9.d r  $\leftarrow$  ]. During measurements of discontinuous processes, this warning is only active when the target object is detected by the pyrometer and the threshold is violated.

ΕN

#### 11.11 Damping function

When the target object's temperature is erratic, the damping function smoothens these temperature fluctuations in order to stabilize the measuring signal. The greater the time constant, the lower the effect of fluctuations on the yielded temperature reading.

Two-colour mode [
$$9 \cup 1 \rightarrow [9 F : L]$$
] One-colour mode [ $L1 \cup 1 \rightarrow [9 F : L]$ ] or [ $L2 \cup 1 \rightarrow [9 F : L]$ ]

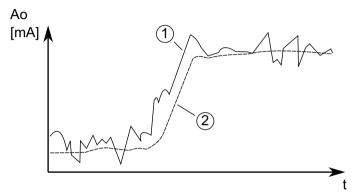

- 1 Output signal without smoothing function
- 2 Output signal with smoothing function

#### 11.12 Peak hold function


It might often be desirable to determine the peak temperature during a defined time period, for example when the objects to be measured move past the pyrometer, resulting in temperature readings which would appear to be cyclical. In this mode, the displayed temperature reading will not drop between targeted objects. The peak temperature reading will be held for a preset time period.

The hold time [ $E \rightarrow \Omega E$ ] can be set from 0.1 to 999.9 sec. The maximum temperatures sampled during the defined hold time will be saved. It make sense to

choose a hold time which is approximate 1.5 time as long as cycle of the moving targets. This avoids temperature drops. Any changes are recognised at once.

Two-colour mode [9] 
$$\rightarrow$$
 [9.9 h d]  $\rightarrow$  [E  $\rightarrow$   $\Omega$ E]

One-colour mode [L I] 
$$\rightarrow$$
 [ 'Phd]  $\rightarrow$  [L  $\rightarrow$   $\Omega$ E] or [L2]  $\rightarrow$  ['Phd]  $\rightarrow$  [L  $\rightarrow$   $\Omega$ E]

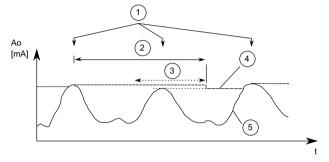

1	Measuring object in front of the pyrometer	
2	Hold time	
3	Second internal hold time	
4	Measuring reading with peak hold function	

5 Measuring reading without peak hold function

#### 11.13 ATD function

This function is used to automatically measure the temperature of a discontinuously running process. For example, it can be used to determine the temperature of bolts passing the pyrometer acyclically and which have a variable length.

The start of a measuring cycle is determined automatically and is dependent on the following variables:



Limit 1 (L   .  )	Before beginning the measurement, the temperature reading must have been lower than Limit 1 at least once.  If Autoreset (A.RST=ON) the limit 1 will be ignored
Limit 2 (L I .2)	Limit 2 must be exceeded at least fort he duration of time delay (T.DEL).
Time delay (논라운 L ):	See above

When the conditions are fulfilled, the sampling time can begin. (T.ACT).

Sampling time	During the sampling time the temperature is detected
(ERCE)	and stored as a temperature value.



If the parameter T.ACT= 0 automatically the end of the discontinuous process is detected. At the parameter T.ACT instead of the time "auto" is displayed.

The parameter (ANO) defines the temperature emitted during the measuring time.

Display mode (₺ 呂 ๑ ๑ )	t=0" displays the lower temperature range limit during
	the measurement. "T.HLD" indicates the previous tem-
	perature reading during the current measurement.

As an option, the green Status LED can light up or the digital output can be used to indicate sampling.

When the sampling time has ended, an average value is calculated for recorded measuring cycles. The temperature reading is weighted with the previously saved average value and added.

1. 3.	Factor for average weighting. If you choose 100%, averaging will be off.
(= ' /	1

The smaller you set the F-PR factor, the stronger the weighting will be.

When the averaging function is activated (F-PR <100%) a plausibility check will be performed. The difference in temperature between the current reading and the previously stored average is established. If the difference is higher than the plausibility threshold TSP, the transmitted data will be "0" and the average value will remain unchanged.

Plausibility (ヒ도유L)	Threshold for plausibility check: lower limit which is acceptable for a valid measurement.
Plausibility (とこ・5)	Threshold for plausibility check: upper limit which is acceptable for a valid measurement.

When sampling is completed, the average temperature value or "0" will be output. At the same time, an impulse is generated which can be used for the digital outputs. Enter M.TR.1 as source and set the holt time to 0.5 sec.

A cut-off interval (time lag) begins after the sampling time has ended. This cut-off interval must expire before the next measurement can start with the cycle starting conditions described above

Cut-off interval	The interval between one completed sampling and
(E.dl S)	the start of a new sampling.

If a measuring cycle does not start during the period T.OUT, the saved average will be deleted and reinitialized when the next cycle begins.


Timeout (EDUE)	Timeout für Mittelfunktion (in Minuten)
----------------	---

Activate auto reset for the ATD function to run cyclically. Limit 1 will then be ignored. Measurement continues when the Limit 2 is exceeded for the period configured with T.DEL.

Auto reset (는 유민단)	Auto reset on/off
--------------------	-------------------

The parameter Set Li2 checks on T. ACT checks, whether the value falls below threshold 2 during the measuring time. If the value falls below the threshold, the measurement is rejected. The display shows "---".

Set Li2 check on tAct	on/off
(F.L.2)	

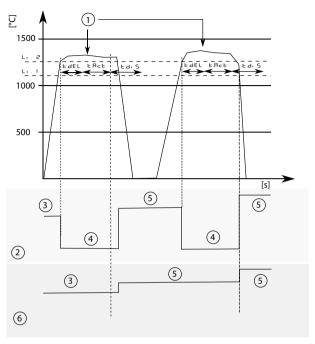

1	Measuring object in front oft he pyrometer	
2	Temperature output E.Roo = oFF	
3	Previous reading	
4	Lower limit of temperature range	
5	New reading	
6	Temperature output E Ano = hold	


#### 11 14 IO-I ink

This device has an IO-Link communication interface, which requires an IO-Link-capable module (IO-Link master) for operation. The IO-Link interface allows direct access to process and diagnostic data and offers the possibility to parameterize the device during operation. The IODDs required for configuring the IO-Link device as well as detailed information on process data set-up, diagnostic functions and parameter addresses are available in the download area at www.keller.de/its.

For IO-Link operation a 3-wire cable port Class A (Type A) must be used.

#### 12 Menu


#### 12.1 Analogue output Ao

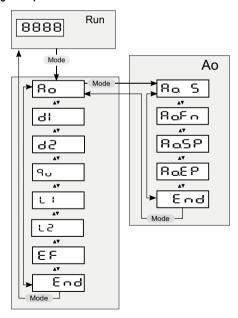


EN



# 12.2 Switching output OUT 1

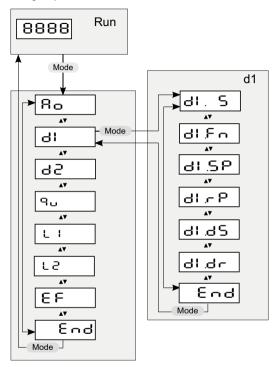


# 12.3 Switching output OUT 2

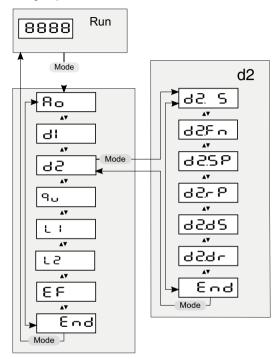

ΕN




#### 12.4 Two-colour channel

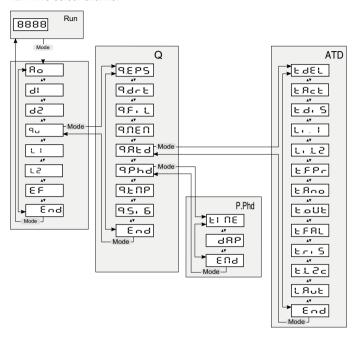

P.Phd	Peak Hold Function Submenu only available when Peak hold function is active
ATD	ADT Function Submenu only available when ATD function is active




#### 12.5 Spectral channel Lambda 1

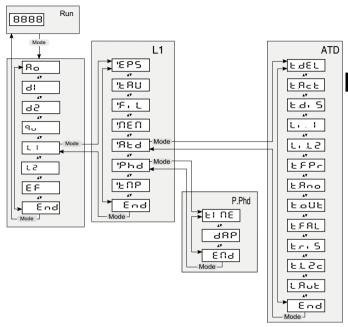

P.Phd	Peak Hold Function Submenu only available when Peak hold function is active
ATD	ADT Function Submenu only available when ATD function is active




#### 12.6 Spectral channel Lambda 2

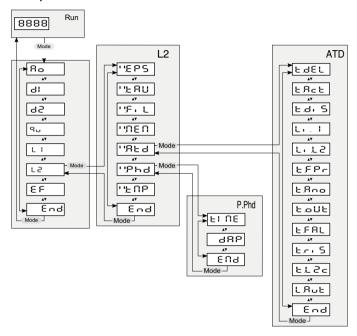

P.Phd	Peak Hold Function Submenu only available when Peak hold function is active
ATD	ADT Function Submenu only available when ATD function is active



#### 12.7 Advanced Features

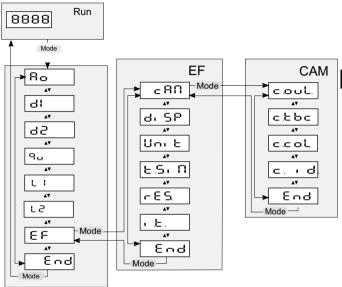

CAM Parameter and submenu only available at pyrometer with camera.



# 13 Menu explanation

# 13.1 Analogue output

Parameter	Function	Comments
8a S	Select source	L I Lambda 1 one-colour mode L 2 Lambda 1 one-colour mode 9 two-colour mode
Rofn	0/4 – 20 mA	0 – 20 mA 4 – 20 mA
RaSP	Define lower limit of temp. span	
RoEP	Define upper limit of temp. span	
End	End	Exit menu

# 13.2 OUT 1 (라 )

Parameter	Function	Comments
dl. S	Select source	L I Lambda 1 L 2 Lambda 1 9 two-colour mode RL I.R ATD tAct (\( \lambda 1 \) RL I.E ATD Trig (\( \lambda 1 \) RL 2R ATD tAct (\( \lambda 2 \) RL 2E ATD Trig (\( \lambda 2 \) RS A ATD tAct (two-colour mode) RS E ATD Trig (two-colour mode) d C dirt alert E U Internal device temperature
dlfn	Output function	hoo hysterese function normally open hoc hysterese function normally closed Foo window function normally open Foc window function normally closed

81.SP	Lower threshold	
dl rP	Upper threshold	
d1.d5	Switch-on delay	0 – 10 s, 0.1 steps
dl.dr	Switch-off delay	0 – 10 s, 0.1 steps
End	End	Exit menu

## 13.3 OUT 2(급급)

Parameter	Function	Comments
a2. S	Select source	L I Lambda 1 L 2 Lambda 1 9 two-colour mode RL I:R ATD thact (\( \lambda \rmathce{1} \)) RL I:E ATD Trig (\( \lambda \rmathce{1} \)) RL 2:R ATD thact (\( \lambda \rmathce{2} \)) RL 2:E ATD Trig (\( \lambda \rmathce{2} \)) R9:R a ATD thact (two-colour mode) R9:E a ATD Trig (two-colour mode) d a dirt allert E U Internal device temperature
d2Fn	Output function	hoo hysterese function normally open hoc hysterese function normally closed Foo window function normally open Foc window function normally closed
42.SP	Lower threshold	
<u> </u>	Upper threshold	
d2.d5	Switch-on delay	0 – 10 s, 0.1 steps
9594	Switch-off delay	0 – 10 s, 0.1 steps
End	End	Exit menu



## 13.4 Two-colour channel ( $Q \cup$ )

Parameter	Function	Comments	
9.8.25	Ratio correction	80 120 %	
9,5-6	Pollution warning level	0.1 - 100	
Relative lower limit, two-colour temperature reading invalid (signal intensity)		0.1 – 100 signal intensity	
9 <i>5</i> , L	Smoothing time	0 - 999,9	
9,08,0	의미트의 Memory function 의미트의 Memory function 의미트를 제공하는 이 Peak-Hold function		
9,864**	Opening of the lower menu level ATD function**		
136.3	Time delay		
ŁЯcŁ	Sampling time		
ا کیا ج	Cut-off intervall		
Lil	Limit 1		
L. 2	Limit 2		
<b>ይ</b> ያየተ	Weighted average	See chapter ATD function	
ŁЯno	Display mode		
300.3	Timeout		
££8L	Threshold for plausibility check: lower limit		
E こ S Threshold for plausibility check: upper limit			



Para	ameter	Function	Comments
	Check, whether threshold 2 is fallen below during the measuring time		See chapter ATD function
	FUR	Timeout	
	End	Closing of the lower menu level ATD function	
۹,۶	hd*	Opening of the lower menu level Peak-Hold function*	
	F: UE	Hold time Peak-Hold function	Time in second
	486	Damping	Damping
	End	Closing of the lower menu level Peak-Hold function	
9.E.N.P		Actual temperature reading	The display shows the actual temperature reading.
9.5	، 6	Signal-intensity	The display shows the actual calculated signal-intensity.
End End		End	Exit menu

<sup>\*</sup> Parameter and lower menu level can only selected with active Peak-Hold function

<sup>\*\*</sup> Parameter and lower menu level can only selected with active ATD function



# 13.5 Spectral channel (L I) (L 2)

Para	Parameter Function Comments		Comments
E.P.:	5	Emissivity	Correction of the radiation properties of the measured object (10110%)
ŁЯ	U	Transmission factor	When using protection shields, the value of the transmission of the used disk can be entered here.
۴۱	L	Smoothing time	
ΠE	Π	Memory function	OFF Off P노년 Peak-Hold function 유년 J ATD function
٩Ł	d**	Opening of the lower menu level ATD Function**	
	136.1	Time delay	
	ŁЯcŁ	Sampling time	
	ا ده، ع	Cut-off interval	
	Li. I	Limit 1	
	Li. 2	Limit 2	
	<sub>ይ</sub> ያየ	Weighted average	
	ხЯიი	Display mode	See chapter ATD function
	FoUE	Timeout	
	££8L	Threshold for plau- sibility check: lower limit	
Threshold for plausibility check: upper limit		sibility check: upper	

Para	ameter	Function	Comments
	Check, whether threshold 2 is fallen below during the measuring time		See chapter ATD function
Closing of the lower menu level ATD Function		menu level ATD	
Phd*		Opening of the lower menu level Peak- Hold Function*	
48P		Hold time Peak-Hold function	Time in sec.
		Damping	Damping
		Closing of lower menu level Peak- Hold Function	
۴۵	٩	Actual temperature reading	The display shows the actual temperatur reading
٤٠	d	End	Exit menu

<sup>\*</sup> Parameter and lower menu level can only be selected with active Peak-Hold Function

<sup>\*\*</sup> Parameter and lower menu level can only be selected with active ATD function



### 13.6 Advanced Features (EF)

Para	ameter	Function	Comments
c 8N*		Opening of the lower menu level of the camera	
c.coul.		Screen insert temperature reading	on off
	c.bbc.	TBC exposure metering	on spot weighted off average
	c.col	White blance	RUE O. automatic るRPL daylight.
	c. + d.	Measuring point number	oFF 1 -99 display of the measuring point number in the camera display
	End	Closing of the lower menu level of the camera	
۵,	SP	Process value display	on current temperature value
Un	٠Ł	Temperature unit	Temperature displayed in °ℂ or °F
E.S. N		Temperature Simulation	A temperature can be simulated
٦٤	5.	Factory settings	Reset to factory settings
٠£		Internal device temperature	The display shows the actual internal device temperature reading
٤٠	4	End	Exit menu

<sup>\*</sup> Parameter only available for models with camera



## 14 Parameterizing

When you reset/adjust the operating parameters, the instrument remains in run mode. It continues to operate, using the current parameter settings, until you have finished configuring by pressing [MODE].

### 14.1 Setting parameters - general information

1	Select main menu  ▶ Press [MODE] to access the main menu.	①
2	► Press [^ oder ^] until the required output function or advanced features is displayed.	MODE V P NO
3	Select parameter  ▶ Press [MODE].	(3) (4)
4	▶ Press [^ or v] until the required parameter is displayed	→ RoFn
5	Change parameter value  ▶ Press [MODE].  > Current parameter value is displayed.	(5) → Y-20
6	<ul><li>Press [^ or v] for 2 second.</li><li>&gt;Display flashes three times.</li></ul>	(e) <b>1</b> () <b>1</b>
7	<ul> <li>▶ Press [^ or v] to change the parameter.</li> <li>▶ Hold key [^ or v].</li> <li>&gt; Numerical values scroll through rapidly.</li> </ul>	7-20
		0-50



#### Confirm parameter value

- ► Press [MODE].
- > The display indicates the parameter. The new value has been saved and will take effect.



#### Exit operating parameter layer

▶ Wait 30 seconds

or

- Press [^ or v] to change to the parameter E □ d . Then press [MODE] to change to the functional menu.
- In the functional menu press [∧ or v] to change to the parameter E n d, then press [MODE].



If you press both keys [^ v] only briefly, you will exit the layer (ESC) function

### 15 Error indications

Overload switching output	S c and flashing of the LED Out 1/2
Overtemperature	Display ot and the process value change with 0.5 Hz
Incorrect connection of supply voltage	The display is turned off
Supply voltage ≤ 16 V	The display is turned off
Temperature below mesuring range	The display shows UL
Temperature above measuring range	The display shows OL



#### 16 Service functions

#### 16.1 Reset all parameters to factory settings

<b>•</b>	[r E S] Select extended functions [E F] in the menu
<b>•</b>	Press [MODE]
>	RES is shown in the display
<b>•</b>	Press the v key for 2 s
>	RES flashed for 2 s
•	Release the key v key and press it again
>	is shown in the display
<b>•</b>	Press [MODE] button
>	The current temperature is shown in the display

#### 16.2 Simulate a desired temperature

- ► [E.S. Π] Select extended functions [E.F.]
- ► Press [MODE]
- > The display shows the previously set temperature
- ► Press the ^ key for 2 s
  - > Temperature flashes 3 times
- ▶ Use the keys ∧ ∨ to set the desired temperature, release the key
- > The display alternately shows  $\xi.5$ .  $\Omega$  and the temperature value
- ► Press [MODE] button
  - > The display shows **と**.5. □ and the simulation is completed

#### Exit operating parameter layer

▶ Wait 30 seconds

or

- Press [^ or v] to change to the parameter End. Then press [MODE] to change to the functional menu.
- In the functional menu press [^ or v] to change to the parameter E □ d, then press [MODE].



#### 17 Maintenace

#### 17.1 Cleaning the pyrometer lens

A soiled lens leads to wrong display of the measured value.

- ▶ Check the lens regularly and clean it, if required.
  - Remove dust by blowing or with a soft brush.
  - Use clean, soft and lint-free cloths or those offered on the market for lens cleaning.
  - For heavier contamination, use washing-up liquid or liquid soap. Then carfully rinse with clear water. Hold the lens downwards.
  - Exert only little preasure on the lens during cleaning to avoid scratches.

#### 17.2 Replacing the protective screen

To protect the pyrometer optics against contamination in harsh industrial environments, an additional protective screen is often used. A contamination of the protective screen also leads to a reduced indication of the measuring value.

- Check the protective screen regularly and clean it if necessary or replace it in case of damage.
  - · Remove dust by blowing or with a soft brush.
  - Use clean, soft and lint-free cloths or those offered on the market for lens cleaning.
  - For heavier contamination, use washing-up liquid or liquid soap. Then carfully rinse with clear water. Hold the lens downwards.
  - Exert only little preasure on the protective glass during cleaning to avoid scratches.

### **A** ATTENTION

Replacement of the protection glass only by authorized person. When removing the protective screen, always wear **protective glasses and -gloves**.




## 18 Models

Pyrometer		
Туре	Temp. range	Application
PX 40	500 - 1400 °C 650 - 1700 °C 750 - 2400 °C 850 - 3000 °C	For measurements in steel, ceramics or cement industries
PX 43	600 - 1400 °C 650 - 1700 °C 750 - 2400 °C 850 - 3000 °C	For measurements of wires or moving objects
PX 44	750 - 2400 °C 850 - 3000 °C	For measurements of Si and SiC crystals
PX 50	500 - 1400 °C	For measurements of materials with varying emissivity
PX 60	300 - 800 °C 400 - 1000 °C	For measurements at low temperatures
PX 64	500 - 1400 °C	CVD chemical vapour deposition


#### 19 Field of view

With a pyrometer with focusable optics, the size of the measurement field is determined by the distance ratio D. The measurement field diameter d at the focal distance is defined by the formula:

$$d = \frac{a}{D}$$



In case of rectangular measurement fields, the horizontal  $D_H$  and the vertical  $D_V$  distance ratio is indicated

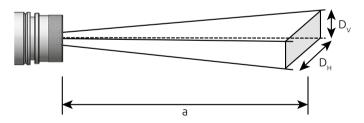

On our website you will find a measurement field calculator. Select the suitable pyrometer, enter the measuring distance and the length of the measurement field and you will get the suitable measurement field course and you can see the size of the measuring spot at the relevant distance.

https://www.keller.de/en/its/tools/field-of-view-calculator.htm



### 20 General technical data

Pyrometer	
Analogue output	0(4) -20 mA linear according NAMUR 43, switchable. scalable load 500 $\Omega$
Switching output OUT1	PNP Open Collector outputs 24 V, ≤ 150 mA Switch point [°C]/ return switch [°C], hysteresis ≥ 2 K, on/switch-off delay, NC/ NO or IO-Link
Switching output OUT2	PNP Open Collector outputs 24 V, ≤ 150 mA Switch point [°C]/ return switch [°C], hysteresis ≥ 2 K, on/switch-off delay, NC/ NO
Ambient temperature	0- 65 °C (without cooling)
IO-Link revision	V1.1, download compatible to V1.01
SIO mode	yes, supported
Transmission rate	COM2 (38.400 Baud)
Storage temperature	-20 – 80 °C
Permissible humidity	95 % r.H. max. (non condensing)
Power supply	24 V DC +10 % / -20 % ripple ≤ 200 mV
Current consumption (without switching output)	≤ 135 mA ≤ 150 mA with laser pilot light ≤ 175 mA with camera
Housing material	Stainless steel
Weight	Approx. 1 kg (according model)
Connectivity	5-pin connection M12 (A coded)
Protection	IP 65 according DIN 40050 with screwed plug



Configuration parameter	Ratio correction $80-120$ % Emissivity $ \Lambda 1, \Lambda 2 \epsilon 10-110$ % Transmission factor $ \Lambda 1, \Lambda 2 $ Smoothing time $ 198 0.1-999.9 $ s Peakhold Function $ 0.1-999.9 $ s ATD function
Sighting device	Through-the-lens sighting with target marking, laser spot light or integrated camera
Dimensions	Ø 65 x 220 mm (without plug)
Camera	
Video system	Composite PAL, 1 Vpp, 75 Ohm
Resolution	722 x 576 pixel
Target brightness control (TBC)	Spot weighted or integrated about the camera image
Screen display	Target marker, measurement
Connection	Pyrometer: TNC plug Monitor: chinch or BNC



# 21 Device-specific technical data

PX 40	
Temperature range	500 - 1400 °C 650 - 1700 °C 750 - 2400 °C 850 - 3000 °C
Sensor	Fotodiode
Spectral sensitivity	0.95 / 1.05 μm
Focussing range	0.3 - ∞ optic PZ 20.08 0.4 m - ∞ optic PZ 20.01 0.2 - 0.4 m optic PZ 10.03 1.2 m - ∞ optic PZ 20.06 0.6 m - ∞ optic PA 20.06 0.2 m - ∞ optic PZ 20.05
Distance to target-size ratio	Temperature range 500 -1400 °C 55:1 (PZ 20.08)  Temperature range 650 – 1700 °C 80:1 (PZ 20.01) 75:1 (PZ 20.03) 120:1 (PZ 20.06) 190:1 (PA 20.06) 20:1 (PZ 20.05)  Temperature range 750 – 2400 °C, 850 -3000 °C 150:1 (PZ 20.01) 140:1 (PZ 20.03) 240:1 (PZ 20.06) 370:1 (PA 20.06) 35:1 (PZ 20.05)
Resolution current output	0.2 K + 0.03 % of selected range
Resolution temperature reading	1 K



PX 40	
Response time t <sub>98</sub>	Temperature range 500 -1400 °C ≤ 10 ms (T > 650 °C)
	Temperature range 650 − 1700 °C ≤ 20 ms (T > 650 °C) ≤ 10 ms (T > 750 °C)
	Temperature range 750 – 2400 °C ≤ 10 ms (T > 950 °C)
	Temperature range 850 -3000 °C ≤ 10 ms (T > 1050 °C)
Measurement uncertainty	1 % (at ε =1.0 and Tu = 23 °C)
Repeatability	2 K
Temperature coefficient with reference to 23°C	≤ 0,05 %/K of temp. reading / K

PX 43	
Temperature range	600 - 1400 °C 650 - 1700 °C 750 - 2400 °C 850 - 3000 °C
Sensor	Fotodiode
Spectral sensitivity	0.95 / 1.05 μm
Focussing range	0.3 - ∞ optic PZ 20.08 0.4 m - ∞ optic PZ 20.01 0.2 - 0.4 m optic PZ 10.03 1.2 m - ∞ optic PZ 20.06 0.6 m - ∞ optic PA 20.06 0.2 m - ∞ optic PZ 20.05
Distance to target-size ratio	Temperature range 600 -1400 °C Dv = 150:1, Dh = 30:1 (PZ 20.08)  Temperature range 650 - 1700 °C Dv = 150:1, Dh = 30:1 (PZ 20.08) Dv = 230:1, Dh = 45:1 (PZ 20.01) Dv = 150:1, Dh = 40:1 (PZ 20.03) Dv = 375:1, Dh = 75:1 (PZ 20.06) Dv = 500:1, Dh = 95:1 (PA 20.06) Dv = 55:1, Dh = 10:1 (PZ 20.05)  Temperature range 750 - 2400 °C, 850 -3000 °C Dv = 350:1, Dh = 50:1 (PZ 20.01) Dv = 330:1, Dh = 45:1 (PZ 20.03) Dv = 580:1, Dh = 85:1 (PZ 20.06) Dv = 730:1, Dh = 105:1 (PA 20.06) Dv = 85:1, Dh = 11:1 (PZ 20.05)
Resolution current output	0.2 K + 0.03 % of selected range
Resolution temperature reading	1 K



PX 43	
Response time t <sub>98</sub>	Temperature range 600 -1400 °C ≤ 10 ms
	Temperature range 650 – 1700 °C ≤ 10 ms (T > 750 °C)
	Temperature range 750 – 2400 °C ≤ 10 ms (T > 950 °C)
	Temperature range 850 -3000 °C ≤ 10 ms (T > 1050 °C)
Measurement uncertainty	1.5 % (at ε =1.0 and Tu = 23 °C)
Repeatability	3 K
Temperature coefficient with reference to 23°C	≤ 0.05 %/K of temp. reading / K

PX 44	
Temperature range	AF 4: 750 - 2400°C AF 7: 850 - 3000°C
Sensor	Fotodiode
Spectral sensitivity	0.95 / 1.05 μm
Focussing range	0.4 m - ∞ optic PZ 20.01
Distance to target-size ratio	150:1 (PZ 20.01)
Resolution current output	0.2 K + 0.03 % of selected range
Resolution temperature reading	1 K
Response time t <sub>98</sub>	AF 4: ≤ 10 ms (T > 950°C)
	AF 7: ≤ 10 ms (T > 1050°C)
Measurement uncertainty	AF 4: Temperature range 750 - 850°C: 6K Temperature range 850 - 1500°C: 0.35% + 2K Temperature range 1500 - 2400°C: 0.5% + 2K
	AF 7: Temperature range 850 - 1500°C: 0.35% + 2K Temperature range 1500 - 2400°C: 0.5% + 2K Temperature range 2400 - 3000°C: 1.0%
	(at ε =1.0 and Tu = 23 °C)
Repeatability	2 K
Temperature coefficient with reference to 23°C	≤ 0.05 %/K of temp. reading / K



PX 50	
Temperature range	500 - 1400 °C
Sensor	Fotodiode
Spectral sensitivity	0.95 / 1.55 μm
Focussing range	0.4 m - ∞ optic PZ 20.01 0.2 – 0.4 m optic PZ 10.03 1.2 m - ∞ optic PZ 20.06 0.2 m - ∞ optic PZ 20.05
Distance to target-size ratio	80:1 (PZ 20.01) 75:1 (PZ 20.03) 120:1 (PZ 20.06) 20:1 (PZ 20.05)
Resolution current output	0,2 K + 0,03 % of selected range
Resolution temperature reading	1 K
Response time t <sub>98</sub>	≤ 30 ms
Measurement uncertainty	1 % (at ε =1.0 and Tu = 23 °C)
Repeatability	2 K
Temperature coefficient with reference to 23°C	≤ 0.05 %/K of temp. reading / K

PX 60	
Temperature range	300 - 800 °C 400 - 1000 °C
Sensor	Fotodiode
Spectral sensitivity	1.5 / 1.9 μm
Focussing range	Temperature range 300 – 800 °C 0.3 m - ∞ optic PZ 20.08
	Temperature range 400 – 1000 °C 0.4 m - ∞ optic PZ 20.01 0.2 – 0,4 m optic PZ 10.03 1.2 m - ∞ optic PZ 20.06 0.2 m - ∞ optic PZ 20.05
Distance to target-size ratio	Temperature range 300 -800 °C 39:1
	Temperature range 400 -1000 °C 80:1 (PZ 20.01) xx:1 (PZ 20.03) xx:1 (PZ 20.06) xx:1 (PZ 20.05)
Resolution current output	0.2 K + 0.03 % of selected range
Resolution temperature reading	1 K
Response time t <sub>98</sub>	≤ 30 ms
Measurement uncertainty	1 % (at ε =1.0 and Tu = 23 °C)
Repeatability	2 K
Temperature coefficient with reference to 23°C	≤ 0.05 %/K of temp. reading / K



PX 64				
Temperature range	500 - 1400 °C			
Sensor	Fotodiode			
Spectral sensitivity	1.5 / 1.9 µm			
Focussing range	0.4 m - ∞ optic PZ 20.01 0.2 – 0,4 m optic PZ 10.03 1.2 m - ∞ optic PZ 20.06 0.2 m - ∞ optic PZ 20.05			
Distance to target-size ratio	80:1 (PZ 20.01) 75:1 (PZ 20.03) 120:1 (PZ 20.06) 20:1 (PZ 20.05)			
Resolution current output	0.2 K + 0.03 % of selected range			
Resolution temperature reading	1 K			
Response time t <sub>98</sub>	≤ 30 ms			
Measurement uncertainty	0.75 % of reading, min. 4 K (at ε =1.0 and Tu = 23 °C)			
Repeatability	2 K			
Temperature coefficient with reference to 23°C	≤ 0.05 %/K of temp. reading / K			

### 22 Field of view camera



- 1 Horizontal extent of the visual filed HFOV
- 2 Vertical extent of the visual filed VFOV
- 3 Field of view pyrometer

Optics	PZ 20.01		PZ 20.03		PZ 20.06	
Measuring distance [m]	HFOV [mm]	VFOV [mm]	HFOV [mm]	VFOV [mm]	HFOV [mm]	VFOV [mm]
0.2			8.5	6.4		
0.3			14	11		
0.4	16	12	20	15		
1	45	34				
1.2	54	41			33	24
2	92.7	70			56	42
3	140	105			86	65
4	188	141			116	87
5	236	177			146	110
6	284	213			176	132
7	332	249			206	154
8	379	285			236	177
9	427	320			266	199
10	475	356			295	222



Optics	PZ 2	20.05	PZ 20.08		
Measuring distance	HFOV	VFOV	HFOV	VFOV	
[m]	[mm]	[mm]	[mm]	[mm]	
0.2	41.7	31.3			
0.3			20	15	
0.4	79.4	59.6	27	20	
1	193	144	70	52	
1.2	230	173	84	63	
2	381	286	142	106	
3	570	427	213	160	
4	759	569	285	214	
5	947	710	357	267	
6	1136	852	428	321	
7	1324	993	500	375	
8	1513	1135	572	429	
9	1702	1276	643	482	
10	1890	1418	715	536	

#### 23 Accessories

A range of mechanical and electrical accessories are available for mounting the pyrometers in industrial environments.

For the selection of the components use the following link:

https://www.keller.de/en/its/pyrometers/accessories.htm

## 24 Default settings

The default settings can be found in the description of the IODD. You can find it on our website www.keller.de/en/its/mediacenter.

## 25 Copyright

The licence information of the Open Source libraries used can be found in the media library on our website www.keller.de/its

ΕN

Copyright prohibits the reproduction or distribution of this instruction manual, including text, photographs or images contained herein, in whole or in part, for any purpose whatsoever, without prior consent of the author. This applies to any form of mechanical or electronic reproduction as well as to electronic transmission in any form through any medium.

#### Please note:

Unless otherwise stated in this instruction manual, the instruments described herein are subject to change without prior notice, particularly modifications for the sake of technological advancement.

© 2019 KELLER HCW GmbH Carl-Keller-Straße 2-10 D-49479 Ibbenbüren-Laggenbeck Germany www.keller.de/its

